




MULTISWITCHES QuiCoax · QuiCoax MULTISWITCHES


AMP QCF 55 · AMP QCF 99




REFERENCIA		REFERENCE			AMP QCF 55	AMP QCF 99
Código		Code			090047	090048
Entradas		Inputs			5 (1x TER + 4x SAT)	9 (1x TER + 8x SAT)
Salidas	Usuario	Outputs	User	Num.	-	
	Cascada		Cascade		5	9
Rango Frecuencias	Canal de retorno	Frequency Range	Return path	MHz	5-65	
	TER		TER		88 -790	
	SAT		SAT		950 - 2150	
Ganancia	Canal de retorno	Gain	Return path	dB	-	-
	TER		TER		20	20
	SAT		SAT		23	23
Regulación	Canal de retorno	Regulation	Return path	dB	-	-
	TER		TER		0-10	0-10
	SAT		SAT		0-10	0-10
Pendiente	TER	Tilt (Fixed)	TER	dB	0-10	0-10
	SAT		SAT		4	4
Nivel máximo entrada (2 canales)	TER	Maximum input level	TER	dB μ V	84	84
	SAT		SAT		87	87
Nivel máximo salida (DIN 45004B-35dBc)	TER	Maximum output level (DIN 45004B-35dBc)	TER	dB μ V	104	104
	SAT		SAT		110	110
Pérdidas de retorno	SAT	Return loss	SAT	dB	>8	>8
	TER		TER		10 (typ)	10 (typ)
Aislamiento	SAT-SAT	Isolation	SAT-SAT	dB	>30	>30
	SAT-TER		SAT-TER		>35	>35
Alimentación del amplificador	Alimentado remotamente	Amplificator feeding	Remotelly fed	Vdc	12	12
	Conectado a la fuente		Connected to PSU			
Consumo	Amplificador	Consumption		mA	200	300
Temperatura de funcionamiento		Working temperature		°C	-20...+45	

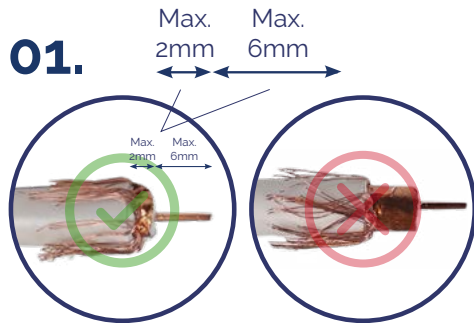

- ES Medidas de pelado de cable
- FR Mesures de dénudage des câbles
- IT Misure di spellatura del cavo
- PT Medidas de decapagem de cabos
- EN Cable stripping measures

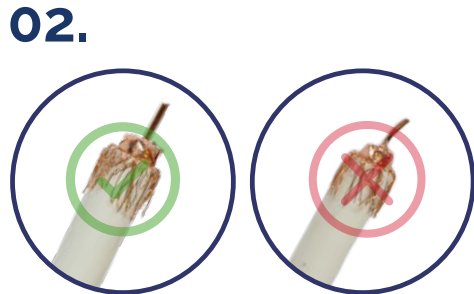


- ES El conductor central debe estar recto
- FR Le conducteur central doit être droit
- IT Il conduttore centrale deve essere dritto
- PT O condutor central deve ser reto
- EN The inner conductor must be straight

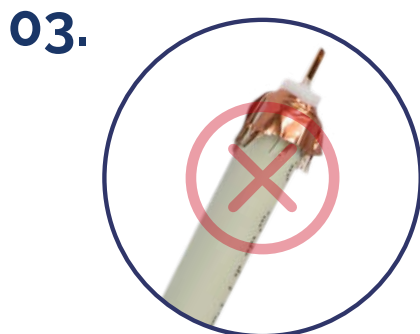

- ES Nunca plegar la lámina de cobre sobre la malla
- FR Ne pliez jamais la feuille de cuivre sur la maille
- IT Non piegare mai la lamina di rame sopra la rete
- PT Nunca dobre a folha de cobre sobre a malha
- EN Never fold the copper foil over the wires



- ES Pulsar el botón e introducir el cable con suavidad
- FR Appuyez sur le bouton et insérez doucement le câble
- IT Premere il pulsante e inserire delicatamente il cavo
- PT Pressione o botão e insira o cabo suavemente
- EN Press the button and insert the cable gently

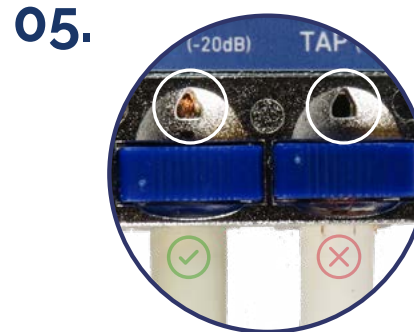

- ES Visualizar la malla a través de la ventana de inspección
- FR Afficher le maillage à travers la fenêtre d'inspection
- IT Visualizza la mesh attraverso la finestra di ispezione
- PT Exibir a malha através da janela de inspeção
- EN If wires can be seen through the inspection window, the connection is correct